All Recommendations

Thursday, October 04, 2012 6:24:04 AM

Record #	ABU	Unit	I/R	Item Nbr	Additional Consideration (Recommendation)	ABU Proposal	Resolution	Verifier Comments	Verifier Name	Verified On	Due Date	RR SOE	Assigned To	Status
16382	RLOP	HNF	2nd Revalid ation	rotor the co Consid	ern is that the feed pump has seized up and caused oupling to come apart. der replacing feed pumps a centrifugal pump	Consider replacing feed pumps with a centrifugal pump and investigate other safeguards to protect the pumps-like motor overamp protection	A project is currently underway to replace the current IMO screw feed pumps at the HNF. Tie ins will be completed in October. Once the project completes CPDEP Phase 3, feed pumps will be ordered. Approximate lead time is 1 year upon reciept of order. g	No additional concerns	Gonzalez, Mauricio E.	10/3/2006	9/26/2007	3 S	Galando, Anthony P.	Completed
16384	RLOP	HNF	2nd Revalid ation	pocke 1650. Consid manif		Consider raising control valve manifold to the next deck or installing eductor to remove liquid	The 86PV778 manifold was moved to the V-1650 deck to eliminate the pocket in the overhead line to K-1960. The V-1650 overhead line was already scheduled for partial replacement during the 1Q07 RLOP Major S/D. I redesigned the PV manifold relocation as part of the overhead line replacement during the S/D. I wrote a revision to existing S/D EWO DE112-E1 to cover the overhead line replacement and 86PV778 manifold relocation in one work package. See RLOP 1Q07 S/D EWO DE112-E1, Revision 1 for details.	The 86PV778 manifold was moved per EWO DE112-E1. This should take care of the issue.	Zayouna, Duraid	4/17/2007	3/1/2007	4 E	MacDonald, David M.	Completed
16385	RLOP	HNF	2nd Revalid ation	m ate r servic Consid	ern is that the bladder rial will degrade over time in re. der PM program on the er. Inspect once a year	Consider PM program on the bladder. Replace once a year. Add one bladder to storehouse stock.	The original proposed solution will not be implemented. An engineered solution is pending.	Procedure rejected, CA not completed. Eric Nelson will ensure a MOC is created and a different soultion instituted per John barthel. Eric Nelsen has inplemented a PM on the bladders	Barthel, John J.	9/13/2007	9/15/2007	3 O	Nelson, Eric J.	Completed

All Recommendations

Thursday, October 04, 2012 6:24:04 AM

Record #	ABU	Unit	I/R	Item Nbr	Additional Consideration (Recommendation)	ABU Proposal	Resolution	Verifier Comments	Verifier Name	Verified On	Due Date	RR SOE	Assigned To	Status
16386	RLOP	HNF	2nd Revalid ation	leaks conti The t TURE excha	nue eam understands that the 80 project will upgrade the anger.	Verify with project team that the upgrade is planned. If not, add to shutdown work list for next major shutdown. Verify the p[roject plans by 10/3/2006. If they are not planning to upgrade, add to next shutdown	1601 is planned for replacement by the TURBO Project with an upsized unit suitable for the higher HNF	I checked with the turbo project team leader to confirm that it is included in the upcoming shutdown	Storrs, Tim R.	12/14/2006	3/30/2007	3 O	MacDonald, David M.	Completed
16530	RLOP	HNF	2nd Revalid ation	and h		Each project has an operations representative assigned from the ABU. The operations rep participates in all reviews and hazard assessments. RLOP ABU will continue to follow the established procedure.	operations representative assigned from the ABU.	RLOP ABU will continue to follow established procedure	Storrs, Tim R.	3/27/2008		6 S		Declined

Totals: 5 Records